

WJ-NX400 Firmware Release Note

VER (ActiveX Ver) Release Date	Priority Rank Level		Priority Rank Level			Contents			
			A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
Ver1.02 (6.0.11.0) Apr.,'17	-						First production.		
Ver1.10 (6.0.16.0) August,'17	C				x		-	-	Changed company name to the new company name.
					x		-	-	Eliminated the limit of maximum number of pre-recording channels. As a result, maximum number of pre-recording channels are changed; - Without camera extension unit (64 channel mode): from 32-ch to 64-ch - Without camera extension unit (128 channel mode): from 64-ch to 128-ch
					x		-	-	Added a screen to calculate how many seconds pre-recording can be done with the current settings.
					x		-	-	In the RAID 5/6 operation, the upper limit number of total number of cameras (A), recording (B), sub stream recording (C) was eliminated; Previous: (A) + (B) + (C) must be 176 or less. New: No limit
					x		-	-	Improved switching the frame rate at multi-screen display according to ON / OFF of sub-stream setting.
					x		-	-	Improved to display only I frame (including long term P) for live of more than 4 screens and for data encryption ON camera. Otherwise, display all received frames.
					x		-	-	Improved FTP download to be available even if the administrator name were 4 or less letters.
					x		-	-	Changed the parameters of upside-down to be sent to the following cameras of WV-SC387, WV-SW397, WV-X6511 and WV-X6531.
				x			Reset may occur in communication with WJ-PU104/WJ-PU108/WJ-PU116.	-	Fixed.
				x			-	-	Supported WV-S6111 and WV-S6131.
				x			-	-	Changed possible to run multiple NX Viewer.
Added on Feb.21,2018					x		When WV-ASM 200 Timeline function is ON, the PC firewall is valid and the exceptional settings of Windows Firewall (described in the WV-ASM200 Operation Manual) are NOT configured.		Fixed.
Ver2.00 (6.0.21.0) Jan.,'18	C				x		-	-	Supported V-series H.265 cameras, WV-V1170, WV-V1330, WV-V2530 and WV-V6430. Cameras must be firmware version 2.62 (or later).
					x		-	-	Added "HDD stand-by control mode". Available to set a mode not to count the operation time of a hard disk drive (HDD stand-by control mode) by temporarily pausing HDDs other than those which are recording or waiting for recording.
					x		-	-	Supported hardware RAID1 of plural volumes; Up to 4-mirroring [4x(2xHDD)] per unit [Maximum: 1 (on WJ-NX400) + 5 (on External unit) = 6 x 4-pair = 24-pair]

WJ-NX400 Firmware Release Note

VER (ActiveX Ver) Release Date	Priority Rank Level				Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents	
	A	B	C	U			
	Issue (Phenomenon)				Occurrence condition	Correspondence	
Ver2.00 (6.0.21.0) Jan.,'18	C			X	-	Supported Camera group recording function; It operates according to the camera group recording setting set in the slave recorder.	
				X	-	Supported Failover function; When you register the license of the failover function, the stand-by recorder substitutes for the recorder in operation (master recorder) and continues recording if the master recorder has an error.	
				X	-	Supported NAS backup function; The recording data (files of n3r/n3a and mp4) can be backed up in the NAS drive.	
				X	-	Supported function as follow; Playing back files on MP4, AAC, network microphone (will be recorded as the audio of the fisheye camera), time-saving playback, Corridor Format in layout, Compatibility view in IE(Internet Explorer) and sub-stream recording setups.	
Ver2.10 (6.0.25.0) Jan.,'18	C			X	-	Supported WV-S4150, WV-S4550L and WV-S4550LM.	
				X	-	Supported "Concurrent User License Kit". WJ-NXC05W must be installed to be controlled by WV-ASM300CLW.	
				X	-	Supported HDD Viewer Software.	
				X	Revised on Jan.17,2018	Supported Energy Efficient Ethernet (IEEE802.3az) Switch. Improved not to correspond to IEEE 802.3az to prevent packet loss occur even if Energy Efficient Ethernet (IEEE802.3az) had not been disabled on the switch side.	
Ver2.11 (6.0.25.0) Feb.,'18	B	x			While using with WV-S4150, WV-S4550L and WV-S4550LM, recording time (recording hours) may shorter than expected.	In case configurations are as follow; Compression: H.265(1) Smart coding (GOP control): On(Advanced) Image capture size: 5M(2192x2192) Image quality/Frame rate: One of FQ/1ips, NQ/1ips, NQ/3ips or NQ/5ips	Fixed.
Ver2.12 (6.0.25.0) Mar.,'18	B	x				Revised on Mar.29,2018	Improved process of data recovery in RAID. Improved tolerance against noise and recovery response in HDD control. *Note: Updating firmware from ver 2.11 (or older) to 2.12 (or newer) takes much longer than previous. It takes Approx. 15min (Max 30 min : In case of connect WJ-HXE400(s). Regardless of the number of WJ-HXE400's connections)
Ver2.20 (6.0.25.0) Apr.,'18	B			X	-	Supported new cameras; WV-X4171, WV-X4571L, WV-X4170, WV-X4171, WV-X4571L and WV-X4571LM	
				X	-	Added user authentication method at accessing camera.	

WJ-NX400 Firmware Release Note

VER (ActiveX Ver) Release Date	Priority Rank Level		Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)			Contents
			A	B	C	
		Issue (Phenomenon)		Occurrence condition	Correspondence	
Ver2.20 (6.0.25.0) Apr.'18	B		x	-	-	Added Static Route function.
			x	-	-	Added function to display online user information.
			x	-	-	Possible to correct (move) camera frame position by manual when registering a face of the face collation function.
			x	-	-	Supported Intelligent auto function and back light compensation function on i-PRO EXTREME cameras.
			x	-	-	Supported holding position of fisheye correction after resuming from camera communication error.
		x	Displaying 2 cameras' picture alternatively while connecting with WV-ASM300.	-	-	Fixed.
		x	Unable to detect an alarm on WV-ASM300 when "On" is selected for the "Additional alarm data" setting of the camera.	-	-	Fixed.
		x	Rebooted (Related to DEC) while switching screens and screen patterns in live picture.	-	-	Fixed.
		x	The recovery start log is not displayed in rare cases nor the hour meter of the replacement HDD may not display even though RAID recovery is started.	-	-	Fixed.
Ver2.21 (6.0.25.0) June,'18	C	x	Live video may be rarely mixed display or black screen by changing the browser 4 screen display changed when browsing on a high spec PC.	-	-	Fixed.
		x	The NX Viewer may terminate unexpectedly when viewing an N3R file with the Viewer.	-	-	Fixed.
		x	-	-	-	Support new cameras as follow; - WV-S8530N and WV-X8570N - WV-S1550L, WV-S2250L and WV-S2550L
Ver2.30 (6.0.28.0) July,'18	U	x	-	-	-	Added the camera partitioning function. Became ability to set displaying / operating camera for each user.
		x	-	-	-	Added a function to format HDDs without stopping recording.
		x	-	-	-	Added a function to remove HDDs without stopping recording.
		x	-	-	-	Added a function to confirm password before removing HDDs.
		x	-	-	-	Added a function to inhibit an alarm pop-up a message.
		x	-	-	-	Added 24-screen in a choice of the setting items as new function.
		x	-	-	-	Support Digest authentication on WJ-GXE500.

WJ-NX400 Firmware Release Note

VER (ActiveX Ver) Release Date	Priority Rank Level				Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents
	A	B	C	U		
	Issue (Phenomenon)				Occurrence condition	Correspondence
Ver2.30 (6.0.28.0) July,'18	U				X	-
					X	-
					X	-
Ver2.40 (6.0.30.0) Nov.,'18	C				X	-
					X	-
					X	-
					X	-
					X	-
					X	-
					X	-
					X	-
					X	Unable to act in associate with the command alarm numbers between 65 to 128.
					X	-
					X	The buzzer kept on sounding even after the event recording.
					X	Storage of various logs may fail.
Ver2.50 (6.0.30.0) Feb.,'19	C				X	-
					X	-
					X	-
					X	Copied data in MP4 from V-series cameras may not be able to play back.
					X	Screen display may collapse depending on the number of cameras to be displayed and settings on the "Change the display position of camera " of the main unit setting menu.

WJ-NX400 Firmware Release Note

VER (ActiveX Ver) Release Date	Priority Rank Level				Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents
	A	B	C	U		
	Issue (Phenomenon)				Occurrence condition	Correspondence
Ver2.50 (6.0.30.0) Feb.,'19	C			x	-	- Improved NTP vulnerability.
			x		ActiveX may not be able to be installed depends on InternetExplorer settings.	- Fixed.
			x		Unable to output HDMI by a certain HDMI-SDI converter.	- Fixed.
				x	-	- Added settings of Smart coding in Easy Start.
			x		The output of the seamless sequence of the sub monitor while in the fisheye correction display on the main monitor, may be delayed by a bit of time.	- Fixed.
				x	Network link errors frequently occur on the PC port.	- Fixed.
			x		Switching from multi-screen to the fisheye correction screen, may take time until the screen changes.	When "Display 1 – screen live image on stream 2" setting is enabled. - Fixed.
			x		The fisheye correction position may be changed by special playback such as high-speed playback after turning the power Off/On.	- Fixed.

Important Information:

When you upgrade the firmware, once power off and on of WJ-NX400 before upgrading. If it were failed, please try it again after turning off and on of WJ-NX400.