

## WV-U1142, U2142L, U2542L and WV-U1542L Firmware Release Note

WV-U1142 WV-U2142L WV-U2542L WV-U1542L	Priority Rank Level	Priority Rank Level				Contents		
		A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
Ver1.00 (5.00.01) June,'20	-					First production		
Ver.1.02 5.00.01 June, '20	C			x		The camera may not record the images in an SD memory card.	-	Fixed.
					x	-	-	Changed the below default setting. - [Internet mode]: from "OFF" to "ON" - [Viewer software (nwc4Ssetup.exe)] - [Smoother live video display on the browser (buffering)] from "ON" to "OFF". <a href="#">(Click here for detail)</a>
					x	-	-	Enhanced security.
				x		-	-	Strengthened the countermeasure against the below phenomenon fixed in Ver.1.01.  Hunting phenomenon that the camera alternately changes the subject brightness to low and high may occur under the both of below conditions: - Shooting outdoors - Shooting when the light level is not stable such as morning
				x	Live image of the stream cannot be displayed and shows the below error message on the blue screen.  "Reached the concurrent access limit. Please try again later."	When recording on the SD memory card with the bit rate of 10Mbps or more	Changed the error message to describe how to resolve the issue.  "Lower the bit rate and then establish the connection again. Or select other stream or JPEG and then establish the connection again."	