

This document describes software package upgrade for WV-X6533LN/S6532LN.

1. Release version: 4.50
 2. Release Note Reference Number: X6533LN_009R

WV-X6533LN, WV-S6532LN, WV-X6533LNS and WV-S6532LNS Release Note

VER (ActiveX VER) Release Date	Priority Rank Level	Priority Rank Level				Contents		
		A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
WV-X6533LN WV-S6532LN	Added: December 21, 2020 WV-X6533LNS WV-S6532LNS							
Ver1.00 (4.50.35) July, '19						First production.		
Ver1.01 (4.50.35) Aug., '19					x	The position of the preset position memory may be shifted in the pan direction.	After turning power off and on, also after making position refresh.	Fixed. Please make sure the existing preset positions after upgrading the firmware.
Ver4.20 (4.50.35) Sept., '19	C				x	-	-	Improved accuracy of the privacy mask position at Pan/Tilt.
					x	-	-	Supported multi-browsers other than the Internet Explorer. Some restrictions apply: click here for details.
					x	-	-	In FTP / SNMP authentication, "Authentication error" is logged in the system log by failing authentication more than a certain condition.
					x	-	-	Supported EasyIpSetup software (Ver4.31R00) and became to display serial numbers of devices.
					x	-	-	Updated (Enhanced) SNMP MIB information. The document of i-PRO camera management information (MIB) is available at the following URL; https://security.panasonic.com/training_support/panasonic_device_integration/snmp-mib/
					x	-	-	Improved so that available to connect with HIKVision recorder by CGI command.
					x	-	-	Improved Pan/Tilt operability when connected to VMS (Video Management Software).
					x	-	-	Fixed.
					x	-	-	Fixed.
					x	-	-	Fixed.
			x	-	-	Fixed.		
			x	-	-	Fixed.		
			x	-	-	Fixed.		
			x	-	-	Fixed.		
			x	-	-	Fixed.		
			x	-	-	Fixed.		
			x	-	-	Fixed.		

Corrected on Nov. 8, 2019

WV-X6533LN, WV-S6532LN, WV-X6533LNS and WV-S6532LNS Release Note

VER (ActiveX VER) Release Date		Priority Rank Level					Contents		
WV-X6533LN WV-S6532LN	Added: December 21, 2020 WV-X6533LNS WV-S6532LNS	Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)							
		A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence	
Ver4.20 (4.50.35) Sept.,'19					x	One of the authentications failed and the sound could not be heard when attempting to connect two sessions at the same time.	-	Fixed.	
					x	-	-	Added displaying a note on the screen at Service in the DDNS setting screen, when "Dynamic DNS Update" or "Dynamic DNS Update (DHCP)" is selected.	
					x	-	-	Improved the characters display in the screen from 2 tones to grayscale for smooth display.	
					x	-	-	Added a CGI command to occur alarm; /Set?Func=SoftTrigger or /cgi-bin/Set?Func=SoftTrigger or /cgi-bin/comalarm.cgi	
					x	-	-	Added tamper detection information to additional information when using the function expansion software "i-VMD"	
					x	-	-	Enhanced security.	
					x	Unable to hear audio in both ONVIF and browser when setting the "Interactive(Half-duplex)" at Audio output and streaming AudioBackChannel in ONVIF.	-	Fixed.	
					x	Zoom stops momentarily for each Zoom operation by making a PTZ operation with ContinuousMove command of ONVIF.	-	Fixed.	
					x	The face best shot image, used to display face search history data in Video Management Software, may not be created properly. (Occurrence frequency: Rare)	-	Fixed.	
					x	The camera may restart unexpectedly by displaying live sequence at network recorder while in recording.	-	Fixed.	
					x	The patrol stop position may shift by becoming longer exposer time such as at night.	-	Fixed.	
					x	The slide-bar for VMD may not be able to be slid.	In Compatibility View mode on Internet Explorer.	Fixed.	
					x	Stop position by patrol may shift when the shutter becomes slower, such as at night.	-	Fixed.	
					x	The camera may restart due to memory access error. (Occurrence frequency: Rare)	-	Fixed.	
			x	Fixed the auto tracking standby display that was displayed as Operation mode display: On. ("AUTO TRACK WAITTING"---->"AUTO TRACK WAITING")	-	Fixed.			
			x	The camera may fail in upgrading of firmware, in VMS (Video Management Software) connection environment (sending a certain CGI command for camera control), and become unable to do Pan/Tilt operation or the like.	-	Upgrade the camera with the file of firmware version 4.20 (or later) for a second time.			

*: ONVIF is a trademark of Onvif, Inc.

Corrected on Oct.9, 2019

Added on Nov.25, 2019

WV-X6533LN, WV-S6532LN, WV-X6533LNS and WV-S6532LNS Release Note

VER (ActiveX VER) Release Date	Priority Rank Level	Priority Rank Level				Contents		
		A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
WV-X6533LN WV-S6532LN Added: December 21, 2020 WV-X6533LNS WV-S6532LNS								
Ver4.22 (4.50.35) Nov., '19	C			x		"Transmission type" and "Multicast address" configured by system configuration tool, may not be saved.	-	Fixed.
						-	-	Improved a phenomenon that CPU load might increase after updating for V4.20.
Ver4.23 (4.50.38) Jan., '20	U					-	-	Supports multi-browsers Google Chrome, Firefox and Microsoft Edge in addition to Internet Explorer for; - the setup screen of the extension function "i-VMD" - i-VMD frame display on the live image - the face detection frame on the live image
						-	-	Changed the company name in the plug-in software Active X to the new one.
Ver4.25 (4.50.38) Mar., '20	C					The camera may restart unexpectedly due to the irregularity in the data transmission/receiving process in the memory. (Occurrence frequency: Rare)	-	Fixed.
						The camera may restart unexpectedly due to the irregularity in the alive monitoring process. (Occurrence frequency: Rare)	-	Fixed.
						The camera may show black images on its "Live" window. (Occurrence frequency: Rare)	-	Fixed.
						-	-	Added "SNMP trap setting" in [Network] > [Advanced] > [SNMP]. (Click here for detail)
						Out-of-focus may occur when "Auto focus" is set to "Off" and the focus is on the preset position.	When irradiating the subject with IR light	Fixed.
Ver4.30 (4.50.38) April, '20	B					-	-	Added a CGI command "/cgi-bin/setup_menu_disp?25fps=1" to make 25/50fps selectable on the "Image capture mode" menu.
						-	-	Private zone setting / Patrol setting: Changed the image display format from JPEG to H264/ H265 to make it easier to check the changes on the image.
						The camera recognizes a specific PoE+ injector as PoE.	The injector does not support the specification of PoE+ negotiation.	Added a CGI command "/cgi-bin/poe_ctrl?mode=on" to force the camera to start operating on PoE+ injector.
						-	-	Improved the response speed of the ONVIF command related to PTZ preset.

*: ONVIF is a trademark of Onvif, Inc.

This document describes software package upgrade for WV-X6533LN/S6532LN.
 1. Release version: 4.50
 2. Release Note Reference Number: X6533LN_009R

WV-X6533LN, WV-S6532LN, WV-X6533LNS and WV-S6532LNS Release Note

VER (ActiveX VER) Release Date		Priority Rank Level				Contents		
WV-X6533LN WV-S6532LN	Added: December 21, 2020 WV-X6533LNS WV-S6532LNS	Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)				*: ONVIF is a trademark of Onvif, Inc.		
		A	B	C	U			
Ver4.30 (4.50.38) April, '20					x	Live image may not be displayed and keeps showing warming-up warning. (Occurrence frequency: Rare)	When the camera has started in the low temperature out of specification. Then, restart the camera after rising to the temperature within specification.	Fixed.
			x			All sessions get disconnected by executing the ONVIF ® commands for changing the framerate and the resolution.	-	Fixed.
				x		-	-	Changed the date character string format for response which responds via SNMP to "DateAndTime" format as it was not transmitted correctly.
					x	-	-	Supports multi-browsers Google Chrome, Firefox and Microsoft Edge in addition to Internet Explorer for; - Playing back the images on SD memory card (Click here for detail)
					x	-	-	Changed the URL, QR code and Data_Matrix linked to the support page on the "Support" menu.
					x	Except Chinese market model, WV-S6533LNH Installing "CA certificate" opens two installation screens, a small window and a tab.	-	Fixed.
					x	On the "/cam" window for mobile terminal, reloading the image will show the normal live images when the camera is switched to the "Access permission" period from inaccessible period.	-	Fixed.
					x	Except Chinese market model, WV-S6533LNH -	-	Improved the response when reconnecting in HTTPS connection on Windows 10.
			x			Selecting the image capture size on the "Image" tab may change the bit rate to 3Mbps.	-	Fixed.
					x	-	-	Changed the default value of ONVIF DefaultPTZTimeout from 2 seconds to 60 seconds.
					x	-	-	Corrected the coordinate of the transmitted contents in ONVIF Metadata.
					x	-	-	Enhanced the access restriction function of SNMP v1/v2. (Click here for detail)

WV-X6533LN, WV-S6532LN, WV-X6533LNS and WV-S6532LNS Release Note

VER (ActiveX VER) Release Date		Priority Rank Level				Contents			
WV-X6533LN WV-S6532LN	Added: December 21, 2020 WV-X6533LNS WV-S6532LNS	Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)				* : ONVIF is a trademark of Onvif, Inc.			
		A	B	C	U				Issue (Phenomenon)
Ver4.30 (4.50.38) April, '20		B		x			The below phenomena occur: - Fail in acquiring the setting data - Fail in upgrading firmware - Auto-pan does not stop at the time set to stop	Under both of below conditions: - "Maximum shutter" is 6/30s or longer - The shooting subject is dark	Fixed.
						x	-	-	Enhanced security.
						x	-	-	Changed the below default setting. - [Internet mode]: from "OFF" to "ON" (Click here for detail)
						x	The process load on the camera may become high unexpectedly when: - The LAN cable of the network disk recorder on thereceiving side is disconnected. - The network disk recorder is powered off. (Occurrence frequency: Rare)	When streaming H.265 video using RTP over RTSP protocol	Fixed.
						x	The camera may not record the images in an SD memory card.	-	Fixed.
			x	-	-	Changed the company name in the plug-in software Active X to the new one.			
Ver4.31 (4.50.38) July, '20		B		x		The camera keeps changing the image brightness to low and high alternately until it is rebooted. (Occurrence frequency: High)	When the camera operates continuously with [Image capture mode] set to the default value "30fps mode" for more than approx. 2 years* without being rebooted. * This period will be shortened to approx 1 year for "60fps mode".	Fixed.	
Ver4.50 (4.50.38) Nov., '20		B		x			The camera may reboot. (Occurrence frequency: Low)	Continued operation of the following: - sequence display with a network disk recorder - sequence display with WV-ASM series software when [Live image source] is set to "Camera"	Fixed.
						x	-	-	Changed the behavior related to bit rate when the communication protocol is changed from "HTTP" to "HTTPS" as below. Previous versions: the camera automatically sets the bit rate to 4 Mbps when the selected one is larger than 4 Mbps. This version or later: the camera does not change the bit rate.
					x	The position or area specified in the below operations is misaligned: - click to adjust the center position on the "Live" page - drag the mouse to select a desired area in the main area of Live image (Occurrence frequency: High)	When "Stabilizer" is "On"	Improved the positioning accuracy.	

This document describes software package upgrade for WV-X6533LN/S6532LN.

1. Release version: 4.50
 2. Release Note Reference Number: X6533LN_009R

WV-X6533LN, WV-S6532LN, WV-X6533LNS and WV-S6532LNS Release Note

VER (ActiveX VER) Release Date		Priority Rank Level				Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents		
WV-X6533LN WV-S6532LN	WV-X6533LNS WV-S6532LNS	A	B	C	U		Issue (Phenomenon)	Occurrence condition	Correspondence
	Ver4.50 (4.50.38) Dec., '20	-					First production.		

*: ONVIF is a trademark of Onvif, Inc.

Important notes for users of Chinese market models only:

- The face detection function does not work when the frame rate is set to 25fps or 50fps.
- Stabilizer does not work when the frame rate is set to 60 fps, 50 fps, or 25 fps.