

WV-S1136/ WVS-2136/ WV-S2136L/ WV-S2236L

WV-S1136 WVS-2136 WV-S2136L WV-S2236L	Priority Rank Level				Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents		
	A	B	C	U		Issue (Phenomenon)	Occurrence condition	Correspondence
1.10 June, '21						1st mass-production.		
1.11 June, '21	C			x		The operation of extension software stops after its trial period has expired. (Occurrence frequency: High)	When the followings steps are performed during the trial period: 1. Register the Registration key while the extension software is running 2. Keep the camera working without restarting it	Fixed.
				x		Monitor output image becomes black. (Occurrence frequency: High)	When the camera is rebooted after changing the [Date/time display] setting from the initial setting at shipment (On) to "Off"	Fixed.
					x	-	-	Supports the [Audio] setting function in the camera individual setting screen of i-PRO Configuration Tool version 2.0*. *To be released in the end of June
				x		Applicable model: WV-S1136 only The image becomes blurred after the camera switches between color mode and black & white mode . (Occurrence frequency: High)	Under the environment with strong IR LED lights	Fixed.

