

## WJ-NX100 Firmware Release Note

VER (ActiveX Ver) Release Date	Priority Rank Level					Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents			
	A	B	C	U	Issue (Phenomenon)		Occurrence condition	Correspondence		
Ver4.40 (6.0.38.0) Aug.,'21	-						First production.			
Ver4.50 (7.0.0.0) Aug.,'21	C				x	-			Supports new cameras: WV-U1130A, WV-U1132A, WV-U1142A, WV-U1532LA, WV-U1542LA, WV-U2130LA, WV-U2132LA, WV-U2140LA, WV-U2142LA, WV-U2530LA, WV-U2532LA, WV-U2540LA, WV-U2542LA	
					x	-			Enabled Message ID setting for Extension software alarm No.1 to No.4 in [REC & event]-> [Advanced setup]-> [Extension software alarm] setup page. Selectable number: from 000 to 255	
					x	-				Added traditional Chinese "繁體中文" to the "Language" drop-down menu in [Basic setup]-> [Date/Language]-> [Language].
					x	The recorder may reboot and downloading recording data fails. (Occurrence frequency: Very rare)	When downloading the recording data from the web browser with the following conditions. Downloading format : MP4 Recording stream : H.264 or H.265 Recording frame rate : 1 ips	Fixed.		
			x	The recorder may stop recording and the live image may not be updated, for approx. 15 seconds, for the following cameras:  Version 1.10 or later of WV-U1130, WV-U1132, WV-U1142, WV-U1532L, WV-U1542L, WV-U2130L, WV-U2132L, WV-U2140L, WV-U2142L, WV-U2530L, WV-U2532L, WV-U2540L, WV-U2542L (Occurrence frequency: Rare)	Perform the following operation with the recording frame rate set to other than 30(25) ips using HDMI monitors.  - With both main monitor and sub-monitor: When the multiscreen layout of one monitor is changed.	Fixed.				