

WV-U1142A, U2142LA, U2542LA, U1542LA, U2140LA, and U2540LA Firmware Release Note

WV-U1142A WV-U2142LA WV-U2542LA WV-U1542LA WV-U2140LA WV-U2540LA	Priority Rank Level				Contents		
	A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
Ver1.30 (4.60.04) Sept., '20	-				First production		
Ver.1.31 (4.60.10) Sept., '21	U			x	-	-	Added a CGI command to transmit H.265/H.264 stream without NAL unit. Without NAL: "cgi-bin/setdata?H264NONALFLG=1" With NAL (default): "cgi-bin/setdata?H264NONALFLG=0"
				x	-	-	Changed the digital signature of the viewer software (nwc4Ssetup.exe) from "Panasonic Corporation" to "Panasonic i-PRO Sensing Solutions Co., Ltd."
Ver.1.32 (4.60.10) Sept., '21	C			x	Unable to obtain the setting information of [Image capture mode] using the CGI command "/cgi-bin/get_capability".	When [Image capture mode] is "16:9 mode (2688x1520 30fps mode)" or "16:9 mode (2688x1520 25fps mode)"	Fixed.
				x	Unable to change the [Image capture mode] using the CGI command "/cgi-bin/set_imgmode".	When changing [Image capture mode] to "16:9 mode (2688x1520 30fps mode)" or "16:9 mode (2688x1520 25fps mode)"	Fixed.
Ver.1.40 (4.60.10) Oct., '21	B	x			The [Stream encoding format] menu is not displayed on the [Setup] screen-> [Image] tab, and H.264 streaming is not available. (Occurrence frequency: High)	-	Fixed.