

WV-S1136/ WVS-2136/ WV-S2136L/ WV-S2236L

WV-S1136 WVS-2136 WV-S2136L WV-S2236L	Priority Rank Level				Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents		
	A	B	C	U		Issue (Phenomenon)	Occurrence condition	Correspondence
1.10 June, '21						1st mass-production.		
1.11 June, '21	C			x		The operation of extension software stops after its trial period has expired. (Occurrence frequency: High)	When the followings steps are performed during the trial period: 1. Register the Registration key while the extension software is running 2. Keep the camera working without restarting it	Fixed.
				x		Monitor output image becomes black. (Occurrence frequency: High)	When the camera is rebooted after changing the [Date/time display] setting from the initial setting at shipment (On) to "Off"	Fixed.
					x	-	-	Supports the [Audio] setting function in the camera individual setting screen of i-PRO Configuration Tool version 2.0*. *To be released in the end of June
					x	Applicable model: WV-S1136 only The image becomes blurred after the camera switches between color mode and black & white mode . (Occurrence frequency: High)	Under the environment with strong IR LED lights	Fixed.
1.20 Sept., '21	C				x	-	-	Added SDK version to the [Software mng.] tab in the [Ext. software] page as below: - Displays SDK version of the camera in "SDK version" under "Unique information" - Displays SDK version of the extension software in "Software version" of each extension software information
					x	-	-	Added the following actions for SD memory card error: - Displays the following alert when a bit rate higher than "8192kbp" is selected in [Max bit rate (per client)*]: "Since the value of "Max bit rate (per client)" of H.265/H.264 recording stream set for "Recording format" is larger than "8192kbps", there is a possibility an abnormality will occur in continuity of recorded video. It is recommended to set it to "8192kbps" or less." - Records SD memory card logs on the [Status] tab in the [Maintenance] page, in the case of loss of recording or abnormal response from an SD memory card - Sends Panasonic alarm protocol "Diag." to the destination servers designated in the [Notification] tab of the [Alarm] page, in the case of abnormal response from an SD memory card
					x	-	-	Increased the maximum password length from 32 to 128 characters for "Authentication" in the [Network] page-> [Advanced] tab-> "SMTP(E-mail)".

WV-S1136/ WVS-2136/ WV-S2136L/ WV-S2236L

WV-S1136 WVS-2136 WV-S2136L WV-S2236L	Priority Rank Level				Priority Rank Level A: Recommend to apply (Major or serious update) B: When issue happened C: Maintenance timing U: Function /Performance improvement (Not Necessary to update)	Contents		
	A	B	C	U		Issue (Phenomenon)	Occurrence condition	Correspondence
1.20 Sept., '21	C				X	-	-	Updated the pre-installed extension software WV-XAE200 (AI-VMD) to the latest version 2.11. Note: Upgrading camera to version 1.20 or later does not update the installed WV-XAE200. To use WV-XAE200 in version 2.11, manually update the WV-XAE200 to version 2.11 or initialize the camera using "INITIAL SET" button after firmware upgrade.
					X	-	-	Improved the detection accuracy of scene change detection (SCD).
					X	-	-	Improved the auto focus performance when switching from color mode to black & white mode.
					X	-	-	Improved the image quality as follows: - Color reproduction accuracy and gradation adjustment when [Super Dynamic(SD)] is "On" - The performance of [White balance] function - The image resolution after digital zoom adjustment
				X		-	-	Corrected the camera response to the "GetVideoEncoderConfigurationOptions" command of ONVIF Profile S.
				X		i-PRO Configuration Tool (iCT) may not display a correct value in "Continuous operation" of the [Status of Cameras] screen.	Within 14 hours after starting the camera.	Fixed.
				X		The camera may restart. (Occurrence frequency: Rare)	When the following two events occur at the same time: - Issue an alarm notification of WV-XAE200 (AI-VMD) - Image transmission stops such as when moving to the [Setup] screen	Fixed.
1.21 Sept., '21	B			X	Firmware upgrade may fail. (Occurrence frequency: Rare)	When upgrading the camera(s) connected to WJ-NX100.	Fixed.	
			X		Image transmission stops. (Occurrence frequency: High)	When the camera receives the CGI command to set Internet mode to "On".	Fixed.	
1.31 Nov., '21	U			X	-	-	Added Link Layer Discovery Protocol (LLDP) setting tab to the [Advanced] tab on the [Network] page.	
				X	-	-	Supports the following extension software free of charge: - WV-XAE203 (AI Non-Mask Detection) - WV-XAE207 (AI Occupancy Detection) Note: Registration key is not required after upgrading to this version.	

WV-S1136/ WVS-2136/ WV-S2136L/ WV-S2236L

WV-S1136 WVS-2136 WV-S2136L WV-S2236L	Priority Rank Level				Contents			
	A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence	
1.31 Nov., '21	U				x	-	-	<p>Changed not to install extension software by firmware upgrade as below:</p> <ul style="list-style-type: none"> - Previous versions : Installs AI-VMD and AI Privacy Guard by firmware upgrade when no extension software is installed on the camera - This version or later : Does not install any extension software by firmware upgrade <p>Note: Pre-installed extension software at factory on this version or later is AI-VMD and AI People Detection.</p>
					x	-	-	<p>Added a CGI command to transmit H.265/H.264 stream without NAL unit.</p> <p>Without NAL: "cgi-bin/setdata?H264NONALFLG=1" With NAL (default): "cgi-bin/setdata?H264NONALFLG=0"</p>
					x	-	-	<p>Added "RAM capacity extension mode" to "Unique information" in the [Software mng.] tab of the [Ext. software] page.</p> <p>When set to "On": RAM capacity becomes 150MB When set to "Off": RAM capacity is 100MB Default: Off</p> <p>Note: Recording on SD memory card is unavailable when "RAM capacity extension mode" is set to "On".</p>
1.40 Dec., 21	B				x	-	-	<p>Supports SSH File Transfer Protocol (SFTP) for image transmission.</p> <p>SFTP setting has been added to the [Setup] page.</p>
					x	-	-	<p>Supports Message Queueing Telemetry Transport (MQTT) for alarm notification.</p> <p>MQTT setting has been added to the [Advanced] tab on the [Network] page.</p>
					x	-	-	<p>Supports TLS 1.3.</p> <p>TLS setting has been added to the "HTTPS" window on the [Advanced] tab in the [Network] page.</p>
					x	-	-	<p>Added supported browser information to the camera response to IP Setting Software and the CGI command "getinfo".</p>
					x	-	-	<p>Changed the alarm name from "Panasonic alarm protocol notification" to "TCP alarm notification".</p>
					x	-	-	<p>Added Subject Alternative Name (SAN) to the certificate signing request (CSR) for creating an HTTPS server certificate.</p>
					x	-	-	<p>Added "NTP test" function to the "NTP" window on the [Advanced] tab in the [Network] page.</p>
					x	-	-	<p>Improved the visibility of camera setting screen as follows:</p> <ul style="list-style-type: none"> - Removed unnecessary titles - Switched the position of "Next" and "Back" button
			x	-	-	<p>Improved to enable image recording on an SD memory card even when "Ext. software mode" is set to "On" on the [SD memory card] tab.</p>		

WV-S1136/ WVS-2136/ WV-S2136L/ WV-S2236L

WV-S1136 WVS-2136 WV-S2136L WV-S2236L	Priority Rank Level				Contents			
	A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence	
1.40 Dec., 21	B			x	Unable to perform multicast transmission. (Occurrence frequency: Rare)	When the camera is started with the following settings: - "DHCP" is selected for "Network Settings" on the[Network] tab of the [Network] page - "Multicast" is selected for [Transmission type]	Fixed.	
					x	-	-	Improved the accuracy of time synchronization with NTP server.
					x	-	-	Improved the camera response to the ONVIF command "CreateAnalyticsModules" when the name of installed extension software includes slash (/).
					x	-	-	Improved the behavior when unsupported extension software "AI-VMD/AI People Counting for 360-degree fisheye" or "AI Privacy Guard for 360-degree fisheye" is installed on the camera as below: 1. Displays "Unsupported software" with software version on the [Ext. software] tab 2. Disables the setting window, registration of Registration Key, and operating schedule setting.
					x	The ONVIF command "CreateRules" does not work. (Occurrence frequency: High)	When the [Image rotation] setting is changed after configuring extension software settings using "CreateRules" command.	Fixed.
					x	-	-	Adjusted the Mic input volume on Google Chrome, Microsoft Edge, and Firefox to be equivalent to Internet Explorer.
					x	Long press on [Manual zoom adjustment] button or [Brightness adjustment] button incorrectly starts text input mode on the button. (Occurrence frequency: High)	On the setup menu of "/tab" window for tablet device.	Fixed.
					x	-	-	Changed the default setting of [Overwrite] from "Off" to "On" on the [SD memory card] tab in the [Basic] page.
					x	-	-	Supports full frame rate streaming and audio output on version 92 or later of Google Chrome or Microsoft Edge browser.
					x	-	-	Modified the French description on the [User. Auth] tab and [Host auth.] tab as below: 1. Camera control - From "Com. cam. Vid" to "Contrôle camera" 2. Live only - From "En dir.sl" to "Flux direct"
			x	The camera temporarily stops image streaming even when there is no change in [Image capture mode]. (Occurrence frequency: High)	When the camera receives the CGI command "/cgi-bin/set_imgmode" for changing the image capture mode.	Fixed.		

WV-S1136/ WVS-2136/ WV-S2136L/ WV-S2236L

WV-S1136 WVS-2136 WV-S2136L WV-S2236L	Priority Rank Level	Priority Rank Level				Contents		
		A	B	C	U	Issue (Phenomenon)	Occurrence condition	Correspondence
1.40 Dec., 21	B			x		The "Display style" setting of OSD unexpectedly changes to "Opaque". (Occurrence frequency: High)	When the camera receives the unsupported CGI command "/cgi-bin/set_camfunc".	Fixed.
			x			Out-of-focus may occur after performing auto-focus.	When performing auto focus under all of the following conditions: - [Super Dynamic(SD)] set to "On" - Ambient illuminance is low - Point light source is captured on the image - Outdoor shooting with deep depth of field	Fixed.
					x	-	-	Improved to manage multiple alarms of AI Occupancy Detection (WV-XAE207) by detection area. This enables alarm detection in Area 2 soon after the alarm detection in Area 1. Note: Version 1.20 or later of WV-XAE207 (AI Occupancy Detection) is required.
1.41 Jan., '22	B				x	-	-	Supports Genetec Stratocast™.
			x			The images just before a power off are not played back from an SD memory card properly. (Occurrence frequency: High)	When the camera is powered off under both of the following conditions: - The camera is recording images on an SD memory card in mp4 format - [RAM capacity expansion mode] is set to Off on the [Software mng.] page	Fixed.